

ROF 1 ARDF 2m receiver

ROF 1 – Change note

Date: 11 Nov 2006

Ed: 1

Author: Jon Sletvold


Covers R3.1.

Change note upgrade to R3.2

Change note 1

VBAT power not connected from pad to the internal signal.

Connect pad on the solder side of the board to the pin of the D2 pin as shown.

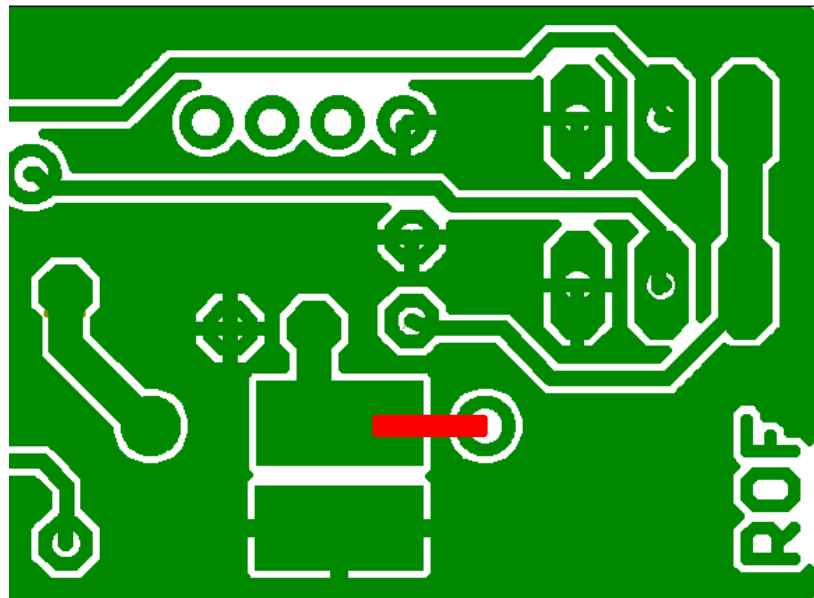

Change note 2

Value changes

ReceiverMainR3

C22 : 15p

C35 : 18p (part list 3.1 was correct, schematic shows wrong value)

AntFilterR3

C1: Not mount

C2: 12p